


## ALL ELECTRIC START 650's ERRATIC STARTER ENGAGEMENT

Erratic electric starter engagement and disengagement on Yamaha 650 twins is often the result of the improper functioning of the three parts described below. Replacement of these parts with the indicated improved parts (only as a set), will generally cure erratic engagement problems.

 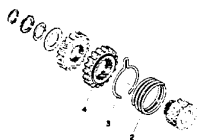


### PARTS LIST (REFERENCE NUMBERS REFER TO TX650A PARTS LIST)

REF. NO.	NEW PART NUMBER	DESCRIPTION	QTY.	PRICE DISC.
7-2	90501-15400-00	SPRING, compression	1	
7-3	90468-29062-00	CLIP	1	
7-4	447-15518-00-00	GEAR 4	1	

NOTE: These parts are standard X5650C parts. They may be used as a set only on all earlier 650 Yamaha twins with electric starters.

The clip (wishbone-shaped spring) position is changed as shown below.



1 2 3 4